

INSTRUCTIONS


1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

SOUTH QUARTER  
 Corner SECTION 17 T. 7N R. 60E P.M.M. Fallon County

FOUND TWO MONUMENTS FOR THE SOUTH QUARTER CORNER OF SECTION 17. I found a rebar with aluminum monument set by Interstate Engineering and described in Corner Recordation (Bk 1, Pg 19) filed July 30, 1982. Interstate Engineering single proportioned and set their monument equal distance between 2 section corner monuments they had previously set. This is the correct procedure for re-establishing a quarter corner. However since I did not accept either position for the 2 section corner monuments they used, I could not accept their position for the quarter corner. The other monument was a 3/4" iron rod similar to those used by the highway department survey crews. The highway plans for Montana State Highway No. 12 dated July 26, 1935 show a Quarter Corner as being found. The plans for the overpass change show a Quarter Corner as being found and a notation stating "1518+80.6 1/4 cor. in pl. rt. to be removed & reset by State forces". I telephoned Montana State Highway Department and they could find no notes as to the identity of the monument or if it was a found monument or a re-established monument. I spoke with Richard Guenzi concerning the monument and he informed me that it had been an accepted monument by previous surveyors (public & private). I accepted the 3/4" iron rod as the correct position for the South Quarter Corner of Section 17.

The two monuments found are referenced to each other as shown below. The monument accepted is referenced to surrounding subdivision corners according to the sketch on the reverse side.

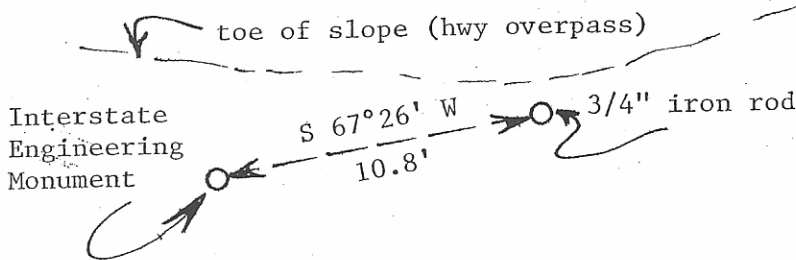

SKETCH OF CORNER

CERTIFICATION

I, Charles M. Madler  
 certify the information shown hereon is true and correct.

Signature of Ground Party Chief  
Charles M. Madler

I, Charles M. Madler  
 certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-2-101 et seq., M.C.A.)

Signature of Surveyor & Seal

Date: 12-20-84 Reg. No. 7327S

Employer: Professional Land Services

Office of Clerk and Recorder, County of Fallon. This "corner record" was filed for record on December 21, 1984 at 9:15A.M. was noted on the cross-index plat and is assigned page No. 121-122, in book No. 1 Fee: N/C

Myra Lee Rieff  
 County Official

Sec. 17


• - corner this sheet