

INSTRUCTIONS

1. Description of monument and accessories set to perpetuate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obscured corner position.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Sec. Corner Sec. 25 T. 4 N. R. 11 W. P.M.M. Anaconda/ County
Sec. 30 T. 4 N. R. 10 W. Deer Lodge

I. Original G.L.O. Record, August 26, 1869 (Because of rugged nature of the southwesterly portion of T.4N., R.10W., the original surveyor elected to make the southerly and westerly boundaries of the township fractional. From the corner common to Sections 33 and 34 on the south boundary of the township, he offsets 160 chains north and 160 chains west to a point which would be the corner of sections 19, 20, 29 and 30. At that point the text reads as follow:)

Thence West 77.72 chains and this being the calculated lengths of the south boundary of the fourth tier of townships north of the base line I set the cor. to sec. 19, 30, 24, 25 a granite stone 18x10x8 ins. with marked stone pits (? , etc. possibly) as per instructions.

From which cor. established I run north on the west boundary of this township Between sec. 19 and 24 ...

Original G.L.O. Record, September 14, 1891 (original field note page no. 2):

I begin at the cor. to Secs. 13, 18, 19, and 24 on the East boundary of T.4N. R.11W. a post which has been reset in position of original corner according to the information and belief of two settlers in this vicinity, whom I have questioned on this matter. The pits are still slightly visible.

Thence I run South between Secs. 19 and 24 ...

40.10 chains

Found an old stake 2½ ins. diam. marked ¼ lying down on ground near fence corner. No pits or mound visible

80.00 chains


Found no sign of any cor. whatever. I therefore set a granite stone 18x11x* ins. 12 ins. in the ground for cor. to Secs. 19, 24, 25, and 30 marked with 4 notches on N. and 2 notches on S. edges; dug pits 18x18x12 ins. in each sec. 5½ ft. dist. and raised a mound of earth 2 ft. high 4½ ft. base alongside. Land nearly level ... No timber.

II. SEE the Certified Corner Record for Section Corner to secs. 18, & 19, T.4 N., R.10 W. and secs. 13, & 24, T.4 N., R.11 W. for complete details of corner location.

Found a granite stone, firmly set, measuring 10"x8"x4" above ground with 2 notches on south face and 4 notches on north face. A small mound of stone to the north. Pits clearly visible in all four sections.

The stone set as the corner to secs. 24, 25, 19, & 30 in 1891 is in fact only the corner common to sections 25 and 30 and controls the Range line to the south as surveyed in 1891.

III. Raised a mound of stone 2-foot to north of stone. Set a T-bar post 1-foot to the south of the stone. Chiseled an "X" at the top center point of the stone.

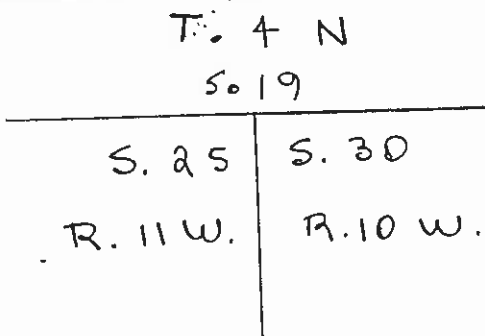

SKETCH OF CORNER


CERTIFICATION

I, David E. Wilson
 certify the information shown herein is true and correct.
 Signature Ground Party Chief

I, Fred L. Hall
 certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, et seq., M.C.A.)
 Signature of Surveyor & Seal

Date: 7/14/95 Reg. No. 8374S
 Employer: Western Micro-Line

Office of Clerk and Recorder, County of Deer Lodge. This "corner record" was filed for record on July 19, 1995 was noted on the cross-index plat and is contained page No. 397, in book No. 2 Mollie Anderson - Deputy
 County Official

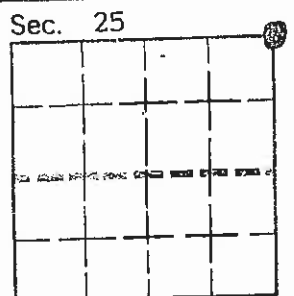

• - corner this sheet