

Missoula County Control Point Datasheet

Monument Description: Stone w/ "x" chiseled on top

Project Name: All

Station Description: Section Corner

Date Visited: Sept. 14, 2010


Monument Stability: C+ **GPS Visibility:** C+

Observer: SEN - CLG

Quad. Name: Bonner

T. 12 N.

R. 18 W. R. 17 W.

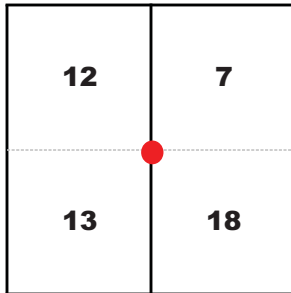

NAD 83 (2007) Lat/Long Position

46°48'26.965"N

113°47'39.363"W

NAVD 88 Elevation: 3361.4 sft.

Notes:

Corner Recordation Form #201003167 incorrectly identifies a 3-1/4" Aluminum Cap, marked 8238, as the monument, the true corner is the original stone, 0.4' west of the aluminum cap.

Photo of Monument



Photo Looking East



Photo Looking West



To Reach: 2wd access to within 30 feet of the monument.



Map of Area

INSTRUCTIONS

- 1 Original and/or subsequent record used to evaluate the corner position.
- 2 Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
- 3 Description of monument and accessories set to perpetuate the corner position.
- 4 Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography lines, position of accessories.
- 5 Corner location must be signed and sealed by Land Surveyor registered in the State of Montana.
- 6 Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION
 Corner Sections 7, 12, 13 & 18 T. 12 N., R. 17 W. & 18 W., P.M.M., Missoula County

1966 Record:
 Find stone well set in place 8" x 8" x 8" above ground, 2 grooves on North and 4 grooves on South faces as described in G.L.O. Record. No other evidence.

Mark as ref:

- A 14" Pine bears N65°E, 26.0 ft. dist. scribed "RM"
- A 14" Pine bears N33°W, 142.9 ft. dist. scribed "RM"

2009 Found:
 Found 3-1/4" aluminum cap firmly set flush with the grounds surface in a ring of stones. Cap is 3.0 ft north of a "T" in an east-west and southerly bound barbed wire fence, just west of a trailer house near the middle of large ~, 250 ft wide high-tension power line swath. Cap was marked as shown below. We found no recordation form on file in Missoula County... but did find the following bearing trees:

- A 24" Ponderosa Pine bears N53°W, 142.5 ft, marked with overgrown heel blaze.
 - A 24" Ponderosa Pine bears N70°E, 26.1 ft, marked with overgrown heel blaze.
- Note: This tree is just south of the trailer house 1 spoke of above.

2009 Perpetuation:
 Due to the found monument being firmly set and in great shape we left the monument as found. We attached new bearing trees to the existing bearing trees as well as the following 6" fence post. This is the fence post at the "T" in the fence lines I previously spoke of:


- A 6" fence post bears S33°W, 3.3 ft.

CERTIFICATION
 I, Jeremy A.F. Garland, certify the information shown herein is true and correct.

Signature of Surveyor
 Signature of Ground Party Chief
 Ken E. Jenkins
 I, Ken E. Jenkins, certify that this Corner Recordation represents work performed by me personally or under my direct supervision in accordance with the provisions of the Montana Code Annotated (70-22-101, et seq., M.C.A.) 33003.

Signature of Surveyor
 Signature of Witness
 Date: 12/20/09 Reg. No. 9330 LS
 Employer: Montana Northwest Company
 P.O. Box 8777, Missoula, MT 59807
 406-721-4033 Project No. 1106-02

SKETCH OF CORNER

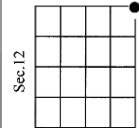

Sec. 12

201003167 B: 855 P: 650 Pages: 1
 02/17/2010 01:56:50 PM Corner Recordation
 01106021003167

Cross Index No. J-L T. 12 N. R. 17W. P.M.M.
 J-25. T. 12 N. R. 18W. P.M.M.

Corner Recordation Form or Other Supporting Document

Point # 5906