

# Missoula County Control Point Datasheet

Monument Description: Stone w/ "x" Chiseled on Top

Project Name: Seeley Lake

Station Description: Section Corner


Date Visited: Aug 11, 2010

Monument Stability: C- GPS Visibility: B

Observer: CLG

Quad. Name: Seeley Lake East

T. 16 N. R. 15 W.

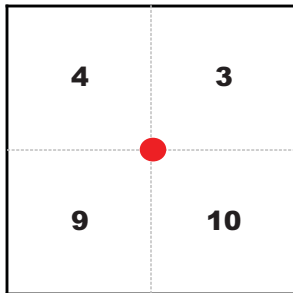

### NAD 83 (2007) Lat/Long Position

47°09'52.438"N

113°29'39.165"W

NAVD 88 Elevation: 4010.4 sft.

### Notes:

Need tall tripod.

Photo of Monument



Photo Looking East



Photo Looking West



Point # 5864

**To Reach:** 2wd access, 300 foot walk from road to monument.



Map of Area

- INSTRUCTIONS**
1. C... and/or subsequent record used to evaluate the corner position.
  2. Discrepancies of evidence found, note discrepancies in the record, state method of establishing lost or obliterated.
  3. Description of monument and accessories, set to perpetuate the corner position.
  4. Sketch of corner, show all pertinent data which can best be shown in a sketch, example, corner marking.
  5. Confirmation must be signed and sealed by Land Surveyor registered in the State of Missouri.
  6. 101 in Cross Index & Section Diagram at bottom of sheet.

**CERTIFIED CORNER RECORDATION**

Corner: Section Corner 3.4.9 and 10 T. 16 N. R. 15 W. P.M.M. Missouri County

**ORIGINAL RECORD:** GLO Surveyor McEllicity, October 18, 1890, set a sand stone 18" x 12" x 8", 12" in the ground for the section corner of sections 3, 4, 9, and 10, marked with 5 notches on the South and 3 notches on the East edges, from which;

- A Fir 25" diam. Beas N30°15'E, 71 lks (46.9') marked "T16N R15W S 3 BT"
- A Pine 30" diam. Beas S37°E, 57 lks (37.6') marked "T16N R15W S 10 BT"
- A Pine 40" diam. Beas S04°50'E, 116 lks (76.6') marked "T16N R15W S 9 BT"
- A Pine 37" diam. Beas N60°50'E, 65 lks (42.9') marked "T16N R15W S 4 BT"

**SUBSEQUENT RECORD:** Corner Recordation document number 320608 - Surveyor Ainsworth, found stone in place and the following BIs (the original BIs found) (1970):

- A Lodgepole Pine 10" diam. S84°W 14.9'
- A Lodgepole Pine 10" diam. N33°W 18.9'
- A Lodgepole Pine 12" diam. N16°30'E 18.6'
- A Lodgepole Pine 10" diam. S70°50'E 28.3' dist.

New BT

**EVIDENCE FOUND:** Found original stone, 6" x 7" x 7" above ground, with 5 notches on the South and 3 notches on the East edges, no original or 1970 BIs found, all trees in area are 4"-5" diam. from which;

- A treated round fence post bears N73°W, 0.4'
- A line of blazed high stumps bears west
- Three treated round fence posts at approx 10' spacing run north Southwest 0.6 feet is a four foot tall rebar with a lath attached

**PERPETUATION:** Left original stone in place. Set a 5" steel fence post east 1.0' Established a BT tag on the N73°W, 0.4' treated post, attached an "Attention" sign to back Corner is on a flat slope, approx, 300' northwest of road.

**CERTIFICATION**

I, Joseph Love, Joseph Love certify the information above is true and correct.  
Signature of Land Party Client

I, Ronald D. Milam, Ronald D. Milam certify that this corner recordation complies with the Missouri Professional Land Surveyors Act, under no direction or control of any other person, firm, corporation or partnership, and that I am duly licensed under my direction in compliance with the "Corner Recordation Act", (MO 23-10) (supp. M.C.A.)  
Signature of Surveyor & Seal

Date: January, 2008. Reg. No. 50072 S.  
 Employer: DISA, P.C.

SKETCH OF CORNER

**200802884**  
 Page 1 of 1  
 10/27/2008 10:41 AM  
 Missouri County Victor N. Zetter, Jr.  
 BK-768 Pp-883

Sec. 3

Cross Index No. E-13 T. 16 N. R. 15 W. P.M.M.