


CERTIFIED CORNER RECORDATION

Corner 1/4 Cor. Secs. 2&11 T. 17 N R. 27W P.M., MT Mineral County

- I. 1899 G.L.O. Record by C.F. Redfield: Set a quartzite stone 14X9X6, 10 ins. in the ground for 1-4 Sec.Cor. , marked 1-4 on N. face; from which
 - A pine 20 ins. diam., bears N.6°30'E., 47 lks. (31.02 ft.) dist., mkd "1-4S2 BT".
 - A pine 24 ins. diam, bears S.10°30'W., 63 lks. (41.58 ft.) dist., mkd " 1-4S 11 BT".
- II. Found stone, 6x10 ins., protruding 7 ins. above the ground, firmly set, mkd. "1/4" on N. face.
 - A root hole with rotten pine pieces bears N.5°30'E., 31 ft., no scribing.
 - A root hole bears S.10°W., 42.5 ft., no remains of wood in the root hole.
- III. At the exact corner position, as determined by the original found stone, set a 2 1/2 in. diam. aluminum pipe, 30 ins. long, 25 ins. in the ground, with a 3 1/4 in. diam. aluminum cap, as shown. A mound of stone surrounds the monument.

See C.O. S. No. _____.

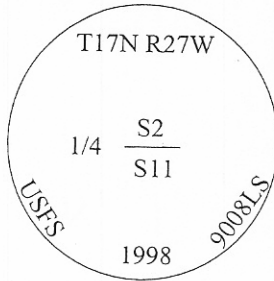


Established two new bearing trees:

- A 7 inch dia. p.pine bears S.53°W., 17.6 ft. dist. mkd. "1/4S11BT".
- A 9 inch dia. D.fir bears N.8°30'W. 26.4 ft. dist. mkd. "1/4S2BT".

Bury the original stone alongside the aluminum pipe.

Painted bearing trees and attached Land Survey Monument and Bearing Tree signs.

Magnetic Declination: 17 1/2° East

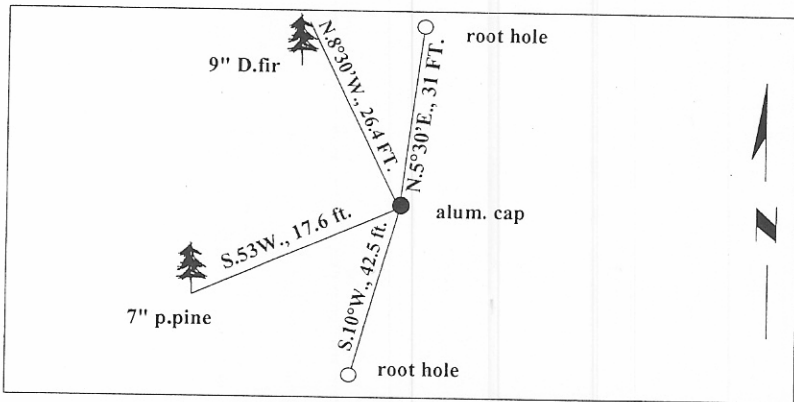

SKETCH OF CORNER

CERTIFICATION

I, Ronald L. Benton
certify the information shown herein is true and correct.

Ronald L. Benton

I, Ronald A. Pearson
certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, et seq., M.C.A.)

Ronald A. Pearson
Signature of Surveyor & Seal

Date: 1/14/99

Reg. No.: 9008LS

Employer: U.S. FOREST SERVICE

Office of Clerk and Recorder, County of Mineral. This "corner record" was filed for record on JAN 26 1999 at 11:55 AM and was noted on the cross-index plat and is assigned page No. _____, in book No. _____.

Donna Davis Shirley Mawcini
County Official

