

**CERTIFIED LAND CORNER RECORDATION**

DESCRIPTION OF CORNER EVIDENCE FOUND, AND ORIGINAL RECORD (IF KNOWN)

The quarter-section corner common to Sections 14 and 15 was probably destroyed by quarrying and road building operations between 1921 and 1932.

(Original Subdivision Record: From Cor. to Secs. 14, 15, 22 and 23, established by me. I run North bet. Secs. 14 and 15, Var. 19° E. 40. Chs. Set magnetite stone 16x14x10 in. 11 in. in the ground for 1/4 sec. cor. marked 1/4 on W. face and raised a mound of stone alongside. Pits impracticable). (Mineral Survey No. 10365 Record: Beginning at Cor. No. 1, Identical with ... S.W. Cor. of Section 14, Frac. T. 9 S., R. 8 E. ... Thence N 0°04' E. along the section line bet. Secs. 14 and 15, T. 9 S., R. 8 E., 1331.6 Feet To Cor. No. 2. ... The West 1/4 Sec. Cor. of Sec. 14, Frac. T. 9 S., R. 8 E. bears N 0°04' E. 1331.6 ft.)

DESCRIPTION OF MONUMENT AND ACCESSORIES ESTABLISHED  
TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

Date of work: 6-2-81

The quarter-section corner was set on a prolongation of the line measured from the section corner common to Sections 14, 15, 22 and 23 and the found monument for Cor. No. 2, N.W. Loc. Cor. of Chalk King No. 1 Lode set by U.S. Mineral Surveyor, Charles T. Sacket for his survey of the Chalk King Claims., Mineral Survey No. 10365. The record distance of 1,331.6 feet from said Cor. 2 to the quarter-section corner was added to the distance of 1,333.41 feet measured from said Cor. 2 to said section corner such that the line from said section corner to the quarter-section corner bears N 0°10'44" W, 2,665.01 feet. For a detailed examination of this procedure see Certificate of Survey No. 542.

Set a 2-inch by 24-inch aluminum pipe monument with a steel core (over)

SKETCH, WITH COURSE AND DISTANCE TO ADJACENT CORNERS IF DETERMINED IN THIS SURVEY.  
(MAY SKETCH OR PASTE REPRODUCTION ON REVERSE SIDE.)

(See reverse side.)

Surveyor's Seal



I, Fred L. Hall  
certify that the information shown herein is true and correct.

*Fred L. Hall*

Signature of Ground Party Chief


I, Thomas J. Hallin  
certify that I have carefully performed or reviewed the work done on the diagrammed corner as reported on this recordation form and approve the same.

*Thomas J. Hallin*

Signature of Surveyor

DIAGRAM OF CORNER:

N. QUARTER-SECTION CORNER

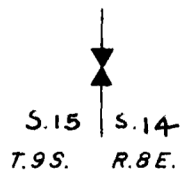

= Corner recorded on the sheet

287 ES  
Registration Number

**165549**

Office of Clerk and Recorder, County of Park

This "corner record" was filed for record on the 5th day of January 1981, was noted on the cross-index plat and is assigned page No. 22, in book No. one

*Margaret Monical*  
County Official

and an aluminum cap marked with standard B.L.M. notation. The base of the monument is set on original ground in a 16'x8' excavation through earth and stone debris on the south side of a steep ridge. An earth filled 3-foot diameter ring of stone was built around the monument to a depth of 17 inches and the remainder of the excavation was filled to the top of the ring of stone. A final 2-foot diameter ring of stone was built around the remaining 7 inches of the monument. A "U" shaped steel post with a M.A.R.L.S. marker on the south side bears northerly, 4.7 feet. RM-North (Surv-Kap and rebar) bears N 0°06'33" E., 80.00 feet. RM-South (Surv-Kap and rebar) bears S 0°10'44" E., 200.00 feet. A twin trunk Douglas fir with RM scribed in a blaze on the north side of the N.W. trunk and a M.A.R.L.S. marker on the south side of the S.W. trunk bears S 3°14'04" E., 107.50 feet.

