

**INSTRUCTIONS**

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

**242129**

**CERTIFIED CORNER RECORDATION**

Corner for Secs. 24, & 25 T. 7N R. 25E P.M.M. Musselshell County

**I. Original 1883 G.L.O. Record:**

North between Secs. 25 and 30...

80 Chs Set a sandstone 15x11x6 ins 10 ins in the ground for Cor. to Secs. 19, 24, 25, and 30 marked 2 notches on S & 4 on N edges & raised a mound of stone alongside. Pits impracticable from which:

- A pine 14 ins. diam. bears N 68° W 83 lks. dist marked T7N R25E S 24 B.T.
- A pine 10 ins. diam. bears N 73° E 126 lks. dist marked T7N R26E S 19 B.T.

**II.** At the location for this corner I found no original evidence of the marked stone or bearing trees. In the area of the corner there is a very ancient North-South fence line. At many points live trees have been used as fence posts and fence wire is embedded deeply in many trees. This is a good indication of as very old fence. There is also another very old fence running westerly from the North-South fence. This fence to the west is located within 1 foot of half way between the found original corner at The Standard Section Corners for Sections 13 and 24 and Sections 25 and 36. I seems obvious that this fence was built in order to conform to the original monument set for Sections 24 and 25. I determined to allow this fence line to control the northing position of this corner. With equity in mind; in view of the old age of the North-South fence I chose to control the easting of the corner by the line of the old fence rather than a straight line measured between the original corner a mile North and South. I therefore accepted the intersection of these two old fences as the best evidence of the original position of the Standard Section Corner common to Sections 24 and 25.

**III.** At the true corner position, I set a 5/8"x24" rebar with a 3" aluminum cap with standard markings. Set a T-bar fence post 1-foot to North. Raised a mound of stone to the West of the corner.

OVER

**SKETCH OF CORNER**

**CERTIFICATION**

I, \_\_\_\_\_  
certify the information shown herein is true and correct.

Signature Ground Party Chief

I, Fred L. Hall  
certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, et seq., M.C.A.)


Fred L. Hall  
Signature of Surveyor & Seal

Date: 10/6/95 Reg. No. 8374S

Employer: Western Micro-Line

Office of Clerk and Recorder, County of Musselshell. This "corner record" was filed for record on October 10, 1995 11:02 AM was noted on the cross-index plat and is assigned page No. \_\_\_\_\_, in book No. \_\_\_\_\_

**JANE E. MANG** by hanna M Weagmann  
County Official

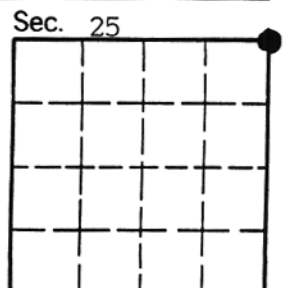

• - corner this sheet

Cross Index No. B-25 T. 7N R. 25E P.M.M.