

Missoula County Control Point Datasheet

Monument Description: 3-1/4" Aluminum Cap 8643S

Project Name: Ninemile Storage

Station Description: 1/4 Corner


Date Visited: Oct. 21, 2008

Monument Stability: C GPS Visibility: B

Observer: SEN

Quad. Name: Huson

T. 15 N. R. 22 W.

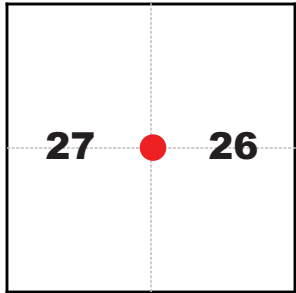

NAD 83 (2007) Lat/Long Position

47°01'49.363"N

114°21'23.109"W

NAVD 88 Elevation: 3124.8 sft.

Notes:

Photo of Monument



Photo Looking Northeast



Photo Looking Southeast



Point # 5804

To Reach: 2wd access to within 250 feet of the monument.



Map of Area

80° 27' 27.4" E DIST 0127

INSTRUCTIONS
1. Original and/or subsequent record used to establish the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing location or collation and
3. Verification of monument and accessories set to perpetuate the corner position.
4. Sketch or corner, show all pertinent data which can best be shown in a sketch example, corner marking.
5. Certification must be signed and sealed by Registered Land Surveyor or State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner $\frac{1}{4}$ 27/26 T. 15 N., R. 22 W., P.M.M. Missoula County

RECORD: 1882
Set a sandstone 16 x 12 x 6 ins., 11 ins. in the ground marked 1/4 on west face from which:
A pine, 24 ins. diameter, bears N. 80° E., 23 lks. (15.18 ft.) dist. marked 1/4 S BT.
A pine, 25 ins. diameter, bears S. 28° W., 34 lks. (22.44 ft) dist. marked 1/4 S BT.

1973:
We establish this corner by proportion between the northeast corner and the southeast corner of section 27. To perpetuate this corner we set a copper/clad brass capped monument and established the following reference monuments:
A pine, 7 ins. diameter, bears N. 30° 00' E., 14.0 ft.
A pine, 8 ins. diameter, bears N. 85° 00' W., 40.0 ft.
A highway right-of-way monument bears S. 55° 53' E., 64.73 ft.

FOUND:
A stone 6 x 12, 10 ins. above ground well set with 1/4 on north face. See attached photo.
A rotten stump, 20 ins. diameter, bears N. 73° E., 15.3 ft. dist. no scribbing visible.
A rotten stump, 20 ins. diameter, bears S. 36° 30' W., 21.8 ft. dist. no scribbing visible.
Also found an Ainsworth 1 1/2 in. copper cap marked as shown:

This cap was found to be in the wrong place, it bears N. 59° 44' 40" E., 17.9 ft. from the original corner position.
A P. pine snag, 9 ins. diameter, bears N. 46° E., 30.4 ft. dist. from the original corner stone scribed RM.
A pine, 9 ins. diameter, bears N. 60° W., 27.5 ft. dist. from the original corner stone scribed RM.

MAINTENANCE:
Replace the stone with a standard USDA aluminum monument with 3 1/4 in. aluminum cap 6 ins. above ground marked as shown:
Buried the stone alongside the pipe.

Established 1 new bearing tree described as follows:
A D. fir, 14 ins. diameter, bears N. 33° 30' E., 21.66 ft. dist. scribed 1/4 S 26 BT.
Placed BT and Land Survey Monument signs.

CERTIFICATION
I, Eddo M. Fluri,
CERTIFIED LAND SURVEYOR LICENSED IN THE STATE OF MONTANA,
do hereby certify that the above information has been verified in the field and correct.
I, Charles A. Flanagan,
SIGNATURE CROSS INDEX CHIEF
do hereby certify that the above information has been verified in the field and correct by me or under my direction in compliance with the "Corner Recordation Act" (19-25 MCA, 19-25 MCA, M.D.A.)
James P. Flanagan
REGISTERED LAND SURVEYOR & LAND SURVEY MONUMENT SIGNER
DATE: 2-5-88 Reg. No. 8643 S

SKETCH OF CORNER
Office of Clerk and Recorder, County of Missoula. This "corner record" was filed for record on the _____ day of 19 _____ in _____ in _____ in _____ book No. _____ was noted on the cross-index plat and is assigned page No. _____
FERRY BART, Missoula County Clerk
County Official
Cross Index No. 7-17 T. 15 N., R. 22 W., P.M.M.
INFINITY
corner this sheet
0127

Corner Recordation Form or Other Supporting Document

Point # 5804