


**CERTIFIED LAND CORNER RECORDATION**  
(REFERENCE FSM 7153.53)

**DESCRIPTION OF CORNER EVIDENCE FOUND, AND ORIGINAL RECORD (IF KNOWN)**

Found a stone 6"x7", 2" above the ground firmly set with 3 notches on S. and E. faces. I believe the stone was moved when the road was built as the GLO position falls on the north edge of the road.  
(Record) Set a sandstone 18"x10"x8", 12" in the ground for cor. to secs. 15, 16, 21 and 22, marked with 3 notches on S. and E. edges.  
Found a 9" Douglas-fir snag bears S.13°45'E., 26.98' with definite blaze overgrowth. Upon opening the blaze overgrowth only a flat blaze is found.  
(Record) A fir 22" diam. bears S.15°E. (37 lks.) 24.42' marked "T17N,R27W S22BT".  
Could not find S15BT. At N.24°30'E., 34' from cap, stump remains of a large tree, could be S15BT.  
(Record) A fir 26" diam. bears N.33°E., 54.78' (83 lks.) marked "T17NR27W S15BT".  
Stump remains bears S.41°30'W., 48.84'. No scribing, badly decayed. (cont. below)

**DESCRIPTION OF MONUMENT AND ACCESSORIES ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:**

Set a standard USDA aluminum pipe with 3/4" diam. alum. cap 5" above ground marked as shown: Date of work: 7-17-79  
Buried stone alongside pipe.  
Piled stones to the west of the monument.  
We established 2 RM trees described as follows:  
A 11" L.P. pine bears S.79°30'E., 40.70' scribed "S22RM".  
A 10" larch bears S.44°W., 63.45'. Scribed "S21RM".  
We posted BT signs on the RM trees and BT's.  
Placed an Attention sign and Land Survey Monument Sign near corner.  
Painted the blaze and mound of stone red.

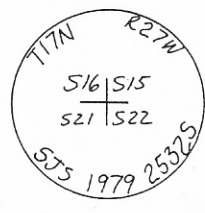

**SKETCH, WITH COURSE AND DISTANCE TO ADJACENT CORNERS IF DETERMINED IN THIS SURVEY. (MAY SKETCH OR PASTE REPRODUCTION ON REVERSE SIDE.)**

(continued from above)  
(Record) A fir 30" diam. bears S.42°W., 48.84' (74 lks.) marked "T17NR27W, S21BT".  
Found an 18" larch stump bears N.24°W., 25.08'. Scribed "T17NR27W, S16BT".  
(Record) A larch 24" diam. bears N.24°W., 25.08' (38 lks.) marked "T17NR27WS16BT".  
We remonumented this corner using intersection of distances - S16 and 21 BT's.

Surveyor's Seal



RONALD L. BENTON

I, RONALD L. BENTON, certify that the information shown herein is true and correct.

*Ronald L. Benton*  
Signature of Ground Party Chief


STANLEY J. SKOUSEN

I, STANLEY J. SKOUSEN, certify that I have carefully performed or reviewed the work done on the diagrammed corner as reported on this recordation form and approve the same.

*Stanley J. Skousen*  
Signature of Surveyor

2532S  
Registration Number

**DIAGRAM OF CORNER:**

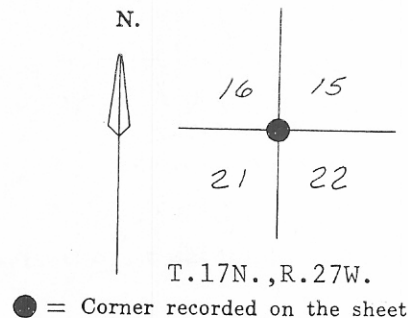

Office of Clerk and Recorder, County of MINERAL

This "corner record" was filed for record on the 7th day of April, 1980, was noted on the cross-index plat and is assigned page No. 504/50, in book No. 504/50

*James L. Dell*  
County Official

Cross Index No. N-13 T. 17N. R. 27W. P.M.M. Mer.