

CERTIFIED CORNER RECORDATION


Corner **Sec. Cor.** **Secs.** 1,2,35&36 **T.** 22&23 N **R.** 30W **P.M., MT** **Sanders** **County**

I. 1893 G.L.O. Record by Rodney W. Page and Arthur Page: Set a granite stone 12x12x8 ins., 8 ins. in the ground for cor. of Secs. 1,2, 35 and 36 marked with 1 notch on E. and 5 notches on W. edges; from which:
 A fir 8 ins. diam., bears N.7°10'E., 30 lks. (19.80 ft.) dist., marked "T23N R30W S36 BT".
 A pine 8 ins. diam., bears S.17°E., 93 lks.(61.38 ft.) dist., marked "T22N R30W S1 BT".
 A pine 13 ins. diam, bears S.83°W., 127 lks. (83.82 ft.) dist., marked " T22N R30W S 2 BT".
 A fir 9 ins. diam. bears N.24°W, 38 lks. (25.08 ft.) dist., marked " T23N R30W S 35BT".

1973 Record by Lawrence J. McCarthy, 1741S: Found original stone and one bearing tree. The stone is turned as 5 notches are on top N. edge, and single notch not visible but appears to be firmly set so I left it in that position. The B.T. found is now 2½' Diam. and Blazed, but no markings can be identified. Deep "W" cut into tree above blaze. 3 other B.T.'s are gone, found 2 stumps S83°W and N.24°W. Original stone and B.T. are adequate. (NOTE: SEE CERTIFIED LAND CORNER RECORDATION DOCUMENT NO. 127967 FILED AT SANDERS COUNTY COURTHOUSE)

1983 B.L.M. Record by Kenny D. Ravnikar, Cadastral Surveyor: The cor. of secs. 1,2,35, and 36, monumented with a granite stone, 12x12x8 ins., firmly set 8 ins. in the ground, mkd. with 5 grooves on the NW. face, from which the remains of the original bearing trees:
 A fir, 26 ins. diam., bears N.7°10'E., 30 lks.(19.80 ft) dist., with scribe mks. visible on a partially chopped open blaze.
 A rotten stump, bears N.4°W., 38 lks.(25.08 ft.) dist., with no visible mks.

At the corner point
 Set an aluminum post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with aluminum cap mkd.

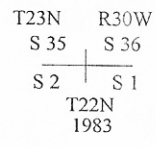

from which
 A fir, 9 ins. diam., bears S.83¼°W., 23 lks.(15.18 ft.) dist., mkd. T22NR30WS2BT.
 A fir, 8 ins. diam., bears N.65¼°W., 36 lks.(23.76 ft.) dist., mkd. T23NR30WS35BT.

Bury the original stone alongside and raise a collar of stone, 3 ft. diam., around the aluminum post. This cor. was perpetuated by Lawrence J. McCarthy, Montana Registered Land Surveyor, No. 1741S, and is accepted as a careful and faithful perpetuation of the position of the original cor. It is recorded in the Sanders County Curthouse, in Thompson Falls, Montana.


II. Found a 2½ inch dia. aluminum pipe with a 3¼ inch dia. aluminum cap 2 inches above the ground marked as shown above.

- A 26 inch dia. D. fir log bears N.7°10'E., 19.8 ft. scribing visible. (1893 BT)
- A stump hole bears N.4°W., 25.08 ft. (1893 BT)
- A 12 inch dia. D. fir log bears S.83¼°W., 15.18 ft. lying on the blaze face. (1983 BT)
- An 8 inch dia. D. fir log bears N.65¼°W., 23.76 ft. scribing visible. (1983 BT)

III. The corner monument is in good condition.
 Made four new bearing trees:
 A 5 inch dia. D. fir bears N.14°E., 40.2 ft. scribed "XBT".
 A 9 inch dia. D. fir bears S.76°E., 42.8 ft. scribed "T23NR30WS1BT".
 A 7 inch dia. D. fir bears S.27°W., 48.3 ft. scribed "T23NR30WS2BT".
 A 13 inch dia. D. fir bears N.60°W., 7.4 ft. scribed "T23NR30WS35BT".

Painted bearing trees red and attached Land Survey Monument and Bearing Tree signs.

Magnetic Declination: 18° East.

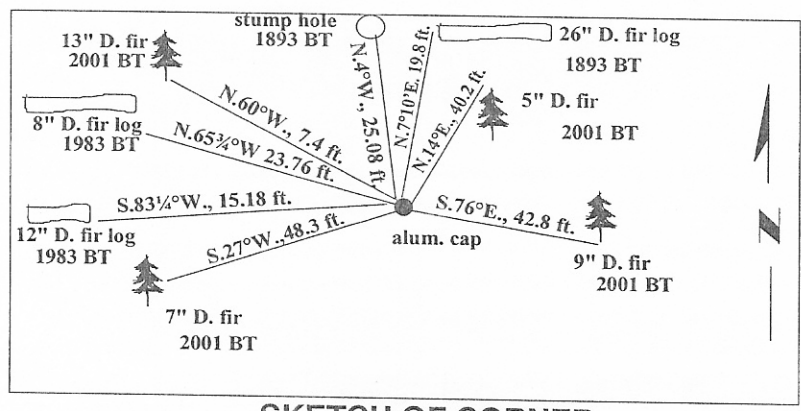

SKETCH OF CORNER

CERTIFICATION

I, Eddo M. Fluri
 certify the information shown herein is true and correct.

Eddo M. Fluri

I, Ronald A. Pearson
 certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, et seq., M.C.A.)

Ronald A. Pearson
 Signature of Surveyor & Seal

Date: 10/02/2001

Reg. No.: 9008LS

Employer: U.S. FOREST SERVICE

Office of Clerk and Recorder, County of Sanders **244280**
 This "corner record" was filed for record on November 1, 2001 @ 11:50 A.M.
 and was noted on the cross-index plat and is assigned page No. _____,
 in book No. 4 888 Pat Ingraham by: Ronald A. Pearson, Deputy
 County Official

